


MONUMENT RECORD

Corner ID: **BeBI_S05**

Quarter Corner



Sections 2 & 11- T10N-R02W, 2nd P.M.
Bean Blossom Township, Monroe County, Indiana

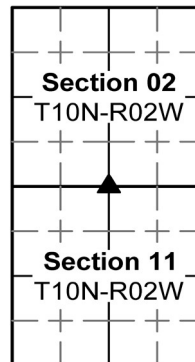

MONUMENT: Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)

(#10130) 5/8" diameter rebar with 2" diameter aluminum cap inscribed MICHAEL E SHEPPARD LS#20100021, found with top 0.2' above ground, on a wooded hillside, 0.4' North of a 2" diameter Hornbeam tree.

MONUMENT LOCATION SKETCH:

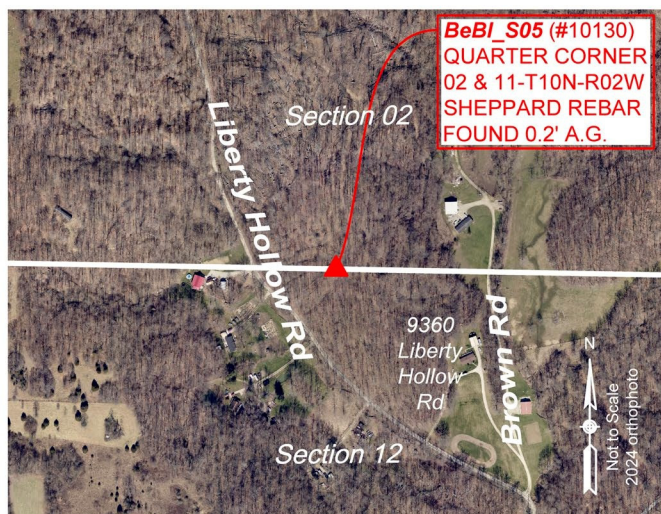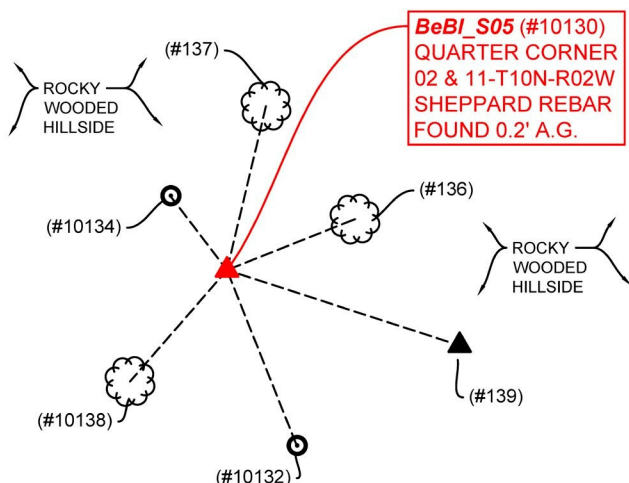

WITNESS MONUMENT TIES: Describe at least three new BT's (Bearing Trees) and/or witness objects established or work done to preserve existing evidence. BT diameters are noted as dbh (diameter at breast height) and are measured approximately 4.5' above ground. Bearings and Distances are measured from the monument to the center of the BT. Bearings and Distances to witness ties were measured with a Sokkia Set 510 Total Station.

ID	Bearing	Distance	Description
(#136)	N68° 08'E	21.5'	10" diameter Red Oak tree.
(#137)	N13° 13'E	26.3'	8" diameter White Oak tree.
(#138)	S41° 20'W	23.0'	18" diameter Sugar Maple tree.

MONUMENT ACCESSORIES

Other survey grade monuments that were located in the vicinity and their relation to the monument. Witnesses noted as a Rebar Lite are a 5/8" diameter by 16" polycarbonate rod with a 1-1/2" mag nail in top and yellow plastic cap stamped "MONROE COUNTY WITNESS POINT" set 0.1 foot below grade unless otherwise noted.

Geodetic coordinates in this table are provided in the format Northing, Easting

(#10132)	S21° 37' 25"E	29.47'	N: 1485028.5499' E: 3088840.9235' Rebar Lite
(#10134)	N37° 30' 42"W	14.54'	N: 1485067.4822' E: 3088821.2080' Rebar Lite
(#139)	S72° 09' 10"E	38.09'	N: 1485044.2726' E: 3088866.3206' Peak on top of 1.5' north-south by 0.2' east-west Limestone found 0.5' above ground.



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

501 N Morton Street Ste 205, Bloomington, IN 47404 • 812-349-2570 • surveyorsoffice@co.monroe.in.us

Page 1 of 4

MONUMENT RECORD

Corner ID: **BeBI_S05**

Quarter Corner

Sections 2 & 11- T10N-R02W, 2nd P.M.
Bean Blossom Township, Monroe County, Indiana

Section 02
T10N-R02W

Section 11
T10N-R02W

PHOTO IDENTIFIED: Photo Date: 05/16/2025



Photo Orientation & Description: From above



Photo Orientation & Description: From West looking East

EXISTING SURVEY HISTORY Include as much detail and history of the corner as known at the time of perpetuation

ORIGINAL GOVERNMENT SURVEY:

Year Surveyed: 1815 By: Thos Brown Deputy Surveyor

Where filed or recorded: Monroe County Original notes page 250

Original monument: Post

Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Distance
Beech	15"	N29°W	10 links
Beech	16"	S29°E	8 links

Notes:

SUBSEQUENT CORNER RESTORATION:

None found

OTHER SURVEY HISTORY: Include details such as surveyor name, date, recording info, monument description, etc.

DocumentDate	SurveyID	Surveyor	Description	InstrumentNo
3/15/2010	RSID004124	Sheppard, Michael E.	162.64 +/- acre survey. Corner ID's BeanBI_S25 & BeanBI_U25, T11N-R02W, are included on plat.	2010003806.IN

ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND BY THE MONROE COUNTY SURVEYORS OFFICE: Include, search area or areas, search procedure, etc.

Date of Field work/Search: 05/16/2025 By: MES/BWM Monument Found: Capped Rebar BTs or Reference Objects Found: No, but references established. Project #: 25-003 Field Book: 58 page 42 & 43. Notes:

OTHER EVIDENCE: Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.

We parked at the South end of a mowed yard of a house at 9370 North Liberty Hollow Road Ellettsville In., and walked West up a hill to its crest, then down a wooded slope approximately 100' from its top to the corner. No distinctive, visible occupation lines were observed in the immediate vicinity of the corner.

MONUMENT PRESERVATION: Describe work done to preserve existing monument.



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

501 N Morton Street Ste 205, Bloomington, IN 47404 • 812-349-2570 • surveyorsoffice@co.monroe.in.us

Page 2 of 4


MONUMENT RECORD

Corner ID: **BeBI_S05**

Quarter Corner

Sections 2 & 11- T10N-R02W, 2nd P.M.

Bean Blossom Township, Monroe County, Indiana

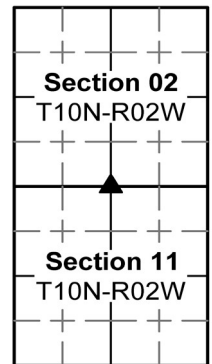

GPS coordinates were established on the Rebar, 2 rebarlites were set within sight of it, that could be used to reestablish its location, should it become obliterated. We also located trees, for visual reference. A steel post with Monroe County Survey marker sign attached, facing East, was driven 0.4' West of the Rebar.

THEORY OF LOCATION: *Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.*

The rebar was found. It was set by me personally in a prior survey dated March 16, 2010, recorded in instrument #20100003806 in the Monroe County Recorder's Office and RSID004124 in the Monroe County Surveyors Office, by single proportionate measurement between the stone found at the Southeast corner of the Section (#1020 BeBI_U05) and the rebar set during the same project at the Southwest corner of the Section (#1051 BeBI_Q05), per the procedures set forth by the bureau of land management for reestablishment of a lost Section corner, since no evidence of the original monument or its accessories or occupation lines are available in the area.

GEODETIC COORDINATES: *Northing:* 1485055.9' *Easting:* 3088830.1'

BASIS OF GEODETIC COORDINATES:

The basis of bearings is Grid North NAD83(2011), Indiana West Zone, Epoch 2010.0000, Geoid Model G2012BU7, Datum NAD83_NO_TRANS, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Coordinate data was collected with a Javad Triumph LS Network Rover and/or with a Sokkia Set 510 Total Station radially from points located with GPS. Distances obtained with GPS have not been adjusted to ground. To adjust grid distances to ground distances multiply them by a scale factor of 1.000041933.

This document is not complete without the associated Corner Perpetuation plat and report of survey for Section 2 Township 10 North Range 2 West by Michael E. Sheppard of the Monroe County Surveyor's Office.



MONUMENT RECORD

Corner ID: **BeBI_S05**

Quarter Corner

Sections 2 & 11- T10N-R02W, 2nd P.M.
Bean Blossom Township, Monroe County, Indiana

Section 02
T10N-R02W

Section 11
T10N-R02W

CERTIFICATIONS:



Michael E. Sheppard

Date: 12/17/2025

Michael E. Sheppard

State of Indiana

Professional Surveyor

No. 20100021



Trohn Enright-Randolph

Date: 12/17/2025

Trohn Enright-Randolph

Monroe County Surveyor



Donna L. Bickel

Accepted by the Monroe County
Surveyor Review Board on

12/17/25



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

501 N Morton Street Ste 205, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 4 of 4